 
 




Site Address:



Inspection Date & Time:



Inspected by:



Mark Yap



mypropinspection@gmail.com



9293868587



M.Y Property Inspection LLC

Client:



LEGENDS



Deficiency

This icon means an inspected item needs to be repaired and is inhibiting the function of the system.



Information

This icon means the statement is for general information about the system. It can also represent an issue that is only cosmetic in nature and not inhibiting function or safety of the system.



Not Inspected

This icon means an inspected item that is an immediate safety risk and should be approached with caution.

TABLE OF CONTENT

General	1.0.0.0.0
Site	2.0.0.0.0
Structure	3.0.0.0.0
Exterior	4.0.0.0.0
Decks, Porches, and/or Balconies	4.1.0.0.0
Roofing	5.0.0.0.0
Chimney	6.0.0.0.0
Plumbing	7.0.0.0.0
Water Heater	7.1.0.0.0
Plumbing Materials	7.2.0.0.0
Fixtures, Traps, and Shutoffs	7.4.0.0.0
Electrical	8.0.0.0.0
Main Disconnect	8.1.0.0.0
Sub Panel	8.2.0.0.0
Heating and Cooling	9.0.0.0.0
Heating	9.1.0.0.0
Cooling	9.2.0.0.0
Garage Door Opener	11.9.0.0.0
Attic	12.0.0.0.0

Header:

This summary page is not the entire report. The complete report may include additional information of interest or concern to you. It is strongly recommended that you promptly read the complete report. For information regarding the negotiability of any item in this report under the real estate purchase contract, contact your real estate agent or an attorney.

- ⊗ 4.0.0.2.0 Exterior (**Contains Images**)
- ⊗ 7.1.0.1.0 Plumbing, Water Heater (**Contains Images**)
- ⊗ 7.4.0.1.0 Plumbing, Fixtures, Traps, and Shutoffs (**Contains Images**)
- ⊗ 9.2.0.1.0 Heating and Cooling, Cooling (**Contains Images**)
- ⊗ 10.0.0.2.0 Interior (**Contains Images**)
- ⊗ 10.0.0.4.0 Interior (**Contains Images**)
- ⊗ 10.0.0.5.0 Interior (**Contains Images**)
- ⊗ 12.0.4.1.0 Attic, Insulation Type (**Contains Images**)

REPORT HEADER

Thank you for the opportunity to conduct a home inspection of the property listed above. We understand that the function of this report is to assist you in understanding the condition of the property to assist in making an informed purchase decision.

The report contains a review of components in the following basic categories: site, exterior, roofing, structure, electrical, HVAC, plumbing, and interior. Additional categories may or may not be included. The report is designed to be easy to read and comprehend however it is important to read the entire report to obtain a full understanding of the scope, limitations and exclusions of the inspection.

In addition to the checklist items of the report there are several comments which are meant to help you further understand certain conditions observed. These are easy to find by looking for their icons along the left side margin. Comments with the blue icon are general informational, comments in black are a restriction on the inspection, and comments with the red icon are also displayed on the summary. Please read them all. Further Evaluation: The component requires further technical or invasive evaluation by qualified professional tradesman or service technician to determine the nature of any potential defect, the corrective action and any associated cost.

1: GENERAL

General Details:

Property Type:

Single Family

Square Footage:

1800

Year Built:

1979

Stories:

2 Stories and 1 Basement

Front Faces:

North

Status:

Occupied

Bystanders Present During the Inspection:

Client

Weather Conditions:

Sunny

Outside Temperature:

85F

Outside Relative Humidity:

55%

2: SITE

Please note that the assessment of the site encompasses a visual inspection of the exterior features including, but not limited to, drainage, landscaping, and paved surfaces such as walkways and driveways. The inspection is restricted to visible and accessible areas at the time of the survey. Underlying or concealed conditions, whether beneath the surface or obscured by vegetation, cannot be accurately determined within the scope of this inspection. Moreover, it should be recognized that environmental conditions can greatly impact the state of the site over time. These conditions may include erosion, changes in drainage patterns, plant growth, or natural disasters, which are beyond the control and predictability of this inspection. While we provide an assessment based on present conditions and foreseeable risks, no guarantee can be given about future changes in site conditions. For a comprehensive evaluation of the land stability or potential soil-related issues, a geotechnical survey by a qualified professional is recommended. Additionally, a professional arborist should be consulted for an in-depth assessment of large trees that may pose a risk to the property.

Site Details:

Walkways Type:

Concrete

Driveway Type:

Asphalt

Walkways Type Images:



Driveway Type Images:



2: SITE

Site Grading Images:



Please be advised that our evaluation of the structural components is inherently limited due to the presence of interior and exterior finishes which may conceal the underlying structure. As such, the disclosure of materials, their condition, and any potential defects are beyond the scope of this inspection. Our characterization of the framing structure is based solely on visible sections within the attic space, and any remarks concerning material type, condition, or identified defects pertain only to the areas that are readily accessible at the time of inspection. Detailed commentary related to any deficiencies discovered within the attic are to be found in the 'Roof & Attic' section of this report. Further, it is important to note that a substantial portion of the foundation, particularly within the interior living areas, is typically obscured by flooring. Consequently, our inspection and subsequent report are restricted to areas of the foundation that are clearly visible and accessible. We recommend a more specialized and invasive inspection if a comprehensive evaluation of the hidden structural elements is required.

Structure Details:

Foundation Types:

Basement

Foundation Material:

Poured Concrete

Floor Structure:

Concrete Slab

Subflooring:

Oriented Strand Board

Wall Structure:

Wood Frame

Roof Structure:

Framed

Assessment:

The structure appeared to be original without modifications or additions. Follow up with the current owner and local building department for a complete history.

4: EXTERIOR

The exterior inspection is a visual assessment of accessible and visible components. It does not imply a guarantee or warranty against future problems, including water penetration. It's always recommended to consult with specialized contractors for a more in-depth evaluation if defects are observed or if any significant renovations or alterations are planned.

Exterior Details:

Wall Covering Material:

Vinyl ,Cement Board

Exterior Door Material Type:

Wood

Window Glazing Type:

Double Pane

Window Types:

Double Hung,Double Slider

Exterior Comments

Comment:

The following comments is for information purpose only:

Description:

- It is highly recommend to place an extension on the gutter downspout to keep the water away from the house.

Remediation:

Owner

Location:

Exterior Gutter
Downspout

4: EXTERIOR



Comment:



The following comments refer to the deficiency for this section:

Description:

- Standing water was found in the gutter.
- Plants was found growing in the gutter.
- The uneven slope on the left portion of the gutter prevents the water to properly flow out from the gutter as shown in the photos.

Recommendation Solution:

- Remove all the plants and leafs in the gutter.
- Recommend to open an opening on the left side of the gutter to allow the water to flow out from the gutter system as discussed during the inspection.

Remediation:

Contractor

Location:

Front Yard Gutter

4: EXTERIOR



Exterior Sides Images:



4: EXTERIOR



4.1: DECKS, PORCHES, AND/OR BALCONIES

Decks, Porches, and/or Balconies Details:

Structure Type:

Concrete

Decking:

Concrete



Railings:

Not Present

Stairs:

Concrete

Structure Type Images:

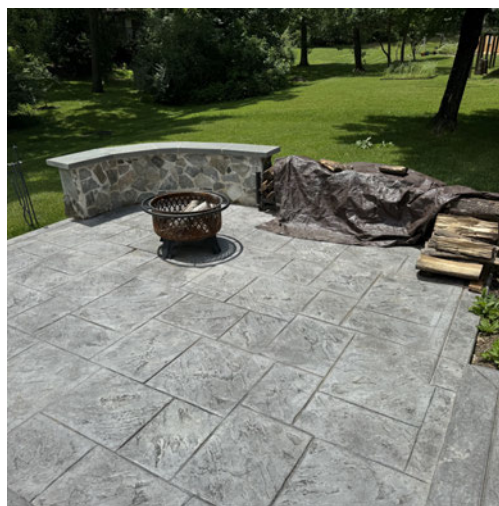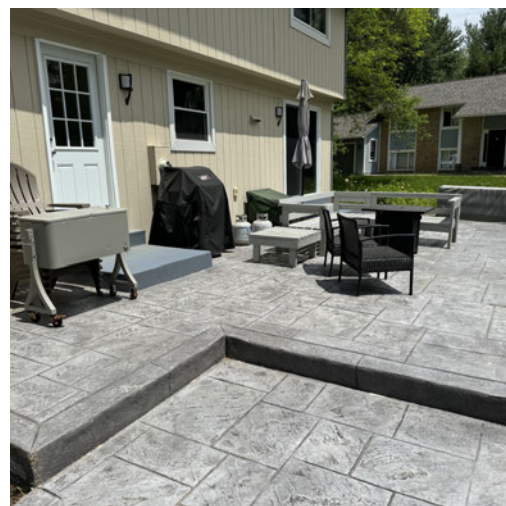

5: ROOFING

The inspection of the roof and its components is a visual examination of the accessible areas of the roof at the time of inspection. This may include the roof coverings, flashings, skylights, chimneys, and roof penetrations. Please note that this inspection does not constitute a warranty or guarantee of the roof's condition or its watertight integrity. Weather conditions and other factors may affect the roof performance, and leaks may occur at any time, even on a roof that appears to be in good condition during the inspection. Inspection of the roof does not include an assessment of its remaining lifespan, the discovery of latent defects, or defects that may only be visible in certain weather conditions or after prolonged periods of specific weather activity, such as heavy rain or wind. Furthermore, this report does not include an assessment of any underground or concealed downspout diverter drainage pipes or whether guttering and downspouts completely divert water away from foundation walls. In case of any concerns or doubts raised in the report, it is recommended to hire a qualified roofing contractor to perform a more in-depth evaluation of the roof, its structure, and components. Finally, regular maintenance of the roof and its components is essential to prolong its lifespan and to detect any potential issues early. Regularly clearing debris from the roof and gutter system, ensuring downspouts are properly diverting water, and checking for any visible signs of damage are all recommended practices.

Roofing Details:

Inspection Method:

Aerial Drone

Geometry:

Gable

Covering Material:

Asphalt Shingle Architectural

Ventilation:

Powered Vent,Soffit Vents

5: ROOFING

Inspection Method Images:



Covering Material Images:

6: CHIMNEY

This chimney inspection is a visual assessment of readily accessible and visible components. It does not include internal evaluations or inspections of concealed areas. It does not guarantee that the chimney is safe or properly functioning. If concerns are identified, it is recommended that a qualified chimney sweep or contractor further evaluate the area and make necessary repairs. It is advised that smoke and carbon monoxide detectors are regularly tested to ensure their functionality.

Chimney Details:

Chimney Material Type:

Brick

Crown Material Type:

Masonry



Flue Type:

Masonry

Fuel Type:

Wood

Chimney Material Type Images:

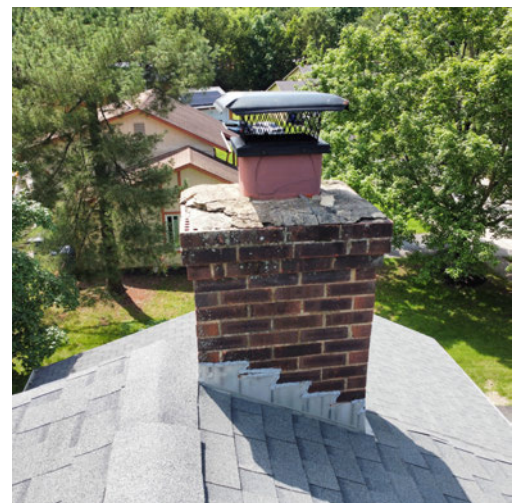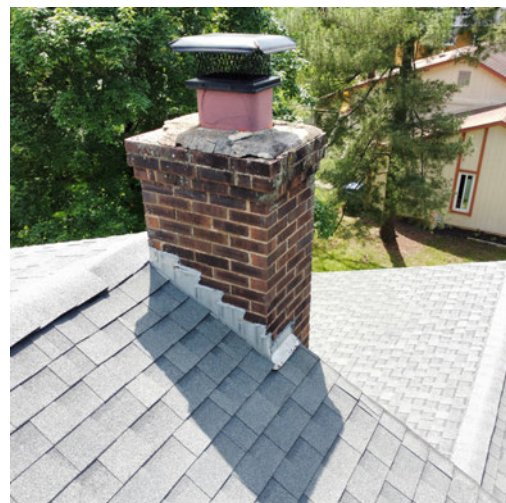

7: PLUMBING

The inspection of the plumbing system is a visual examination of the accessible areas of the plumbing at the time of the inspection. This includes visible and accessible components of the water supply and distribution system, drains, waste and vent systems, water heating equipment, and the placement of main water and main fuel shut-off valves. Please note, this inspection does not involve any invasive procedures, disassembly of components (including water heater and boiler), or turning any shut off valves or backflow preventers. The interior of pipes, sewer lines, sealed plumbing components, or concealed parts of the system are not directly inspected. Detection of water leaks is limited to visual observation of active leaks at the time of inspection. Furthermore, the inspection does not guarantee the system's capacity or performance, as it is not a pressure test of the water system or a test of the sewer line or septic system.

Determination of whether the sewer line is free of defects, roots, or blockages; the condition of any underground or concealed plumbing components; or the presence of any non-functional valves or pipes is outside the scope of this inspection. Should the report mention any concerns, it is strongly recommended to have a more comprehensive examination of the system by a licensed plumbing contractor. To help maintain your plumbing system in good working condition, it is advised to regularly check for leaks, ensure pipes in unheated areas are adequately insulated to prevent freezing, and flush your water heater as recommended by the manufacturer. Please note that the lifespan of plumbing components can vary greatly depending on various factors including, but not limited to, the quality of the materials, the quality of the installation, the level of maintenance, and the type of usage. As such, predicting future conditions or the remaining lifespan of the components is beyond the scope of this inspection.

Plumbing Details:

7: PLUMBING

Sewage Management:

The waste disposal system of this property is listed as being connected to a public or community sewage system. It was not possible to access or inspect the underground components and connections of the system in order to positively confirm this. Contact the local utility provider to confirm that the home is served by a public or community sewer system as listed. The Homeowner may be able to provide records that address this.

Water Meter Location:

Basement

Primary Water Shutoff Location: Water Supply Pressure:

Basement

7: PLUMBING

Water Meter Location Images:



Primary Water Shutoff Location Images:




7.1: WATER HEATER

Water Heater Details:

Location: Basement	Type: Tank
Energy Source: Electric	Manufacturer: Rheem
Manufactured Year: 2023	Capacity: 50 Gallon
Functionality: Operational	



 Water Heater Comments



7.1: WATER HEATER

Comment:



The following comments refer to the deficiency for this section:

Description:

- The water heater tank is missing the temporary relieve valve (TPR Valve). This needs to be install because the temperature of the water that flow out from this valve is really high.

Recommendation Solution:

- Refer to water heater technician to evaluate the situation and perform proper repair.

Remediation:

Contractor

Location:

Water Heater



7.1: WATER HEATER

Location Images:



Manufactured Year Images:



7.2: PLUMBING MATERIALS

Plumbing Materials Details:

Water Supply Material:

CPVC

Vent Material:

PVC

Drain and Waste Material:

PVC

Drain and Waste Material Images:



7.4: FIXTURES, TRAPS, AND SHUTOFFS

Fixtures, Traps, and Shutoffs Comments

Comment:



The following comments refer to the deficiency for this section:

Description:

- The sump pump is still functions properly, however, it is obvious that it past its life expentency.

Recommendation Solution:

- Highly recommend changing the sump pump in the upcoming days.

Remediation:

Contractor

Location:

Sump Pump



8: ELECTRICAL

The inspection of the electrical system is limited to visible and readily accessible components at the time of the inspection. This may include service entrance conductors, service equipment, main overcurrent devices, main and distribution panels, amperage and voltage ratings of the service, ground bonding, switch and receptacle operation, ground fault circuit interrupters (GFCI), arc fault circuit interrupters (AFCI), and presence of smoke and carbon monoxide detectors. Please note that this inspection does not involve disassembly of electrical fixtures, receptacles or panels; removal of panel coverings that are painted shut or sealed; or manipulation of overcurrent protection devices. It does not include any examination of hidden wiring, underground wiring, low voltage systems, telephone, security, cable TV, intercoms, alarm systems, or any off-site remote control systems. While every attempt is made to identify and report on safety hazards or deficiencies, this inspection does not imply or guarantee future conditions, safety, or compliance with any electrical code or manufacturer's specifications. Electrical repairs, replacements or evaluations should only be made by qualified, licensed electricians. Given the potentially fatal risks associated with electricity, homeowners should never attempt to do their own electrical work unless they are properly trained and equipped. Regular professional maintenance and prompt attention to any potential issues is highly recommended. Regularly testing your home's safety devices, such as GFCIs, AFCIs, smoke and carbon monoxide detectors, is also advised. This report does not provide a detailed inventory of every individual electrical component in the house, and it does not determine whether "knob and tube" or aluminum wiring might be buried or hidden behind finished surfaces. If the house contains any DIY (do-it-yourself) wiring, or if any modifications or additions were made by a previous homeowner, we recommend that you have the system evaluated by a licensed electrician.

Electrical Details:

Service Entrance Type:

Underground

Utility Meter Location:

Rear Side

8: ELECTRICAL

Service Voltage:

240/120 Volts


Grounding Type:

Ground Rod

Fault Protection:

Ground Fault Circuit Protection

Service Entrance Type Images:

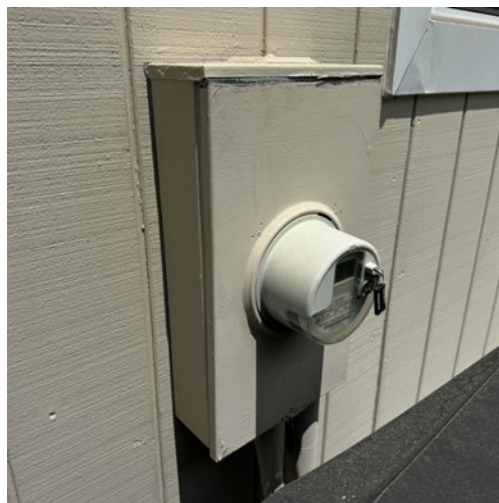

8.1: MAIN DISCONNECT

Main Disconnect Details:

Location:

Basement

Panel Manufacturer:

GE

Panel Amperage Rating:

200 amp


Disconnect Amperage Rating:

200 amp

**Predominant Branch Circuit
Wiring Method:**

Copper NM

Location Images:

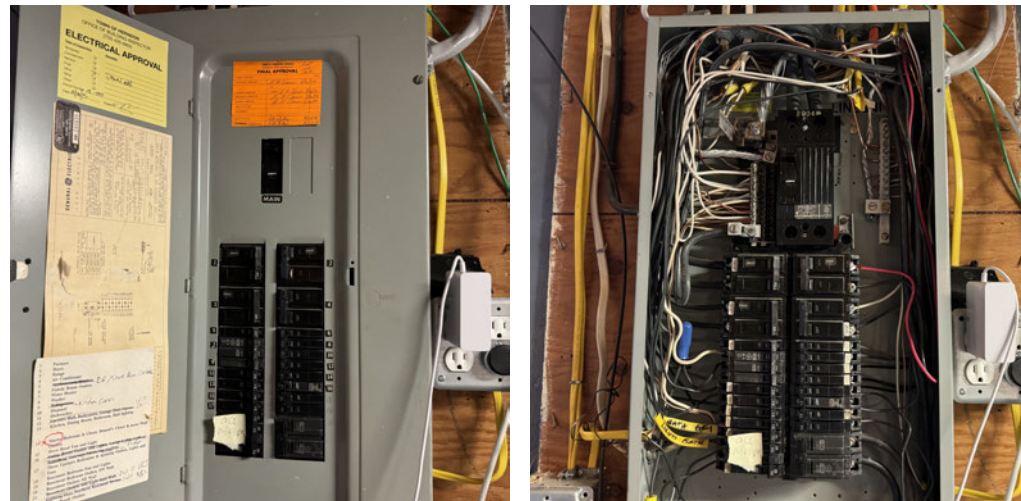

8.2: SUB PANEL

Sub Panel Details:

Location:

Garage

Panel Manufacturer:

GE

Panel Amperage Rating:

Unspecified

Location Images:



The inspection of the heating and cooling system includes a visual and operational check of the readily accessible components at the time of inspection. This may include the furnace or boiler, heat pump, central air conditioning system, ductwork, thermostats, and filters. Please note, this inspection does not involve disassembly of equipment, activation of cooling systems when ambient temperatures risk damage, assessment of heat exchanger integrity, humidifiers, air purifiers, motorized dampers, heat pump defrost controls, or evaluation of refrigerant levels. The interior of chimneys or flues, which are not readily accessible, are also not inspected. While every effort is made to determine the system's general condition and operability, this inspection does not imply or guarantee future performance, longevity, efficiency, or overall safety of the system. It is also beyond the scope of the inspection to determine whether the size or capacity of the heating or cooling system is adequate for the home. Furthermore, due to the large number of components and the complex nature of HVAC systems, the evaluation is inherently limited in scope and not all potential issues may be identified. Repairs, replacements or evaluations should only be carried out by licensed HVAC contractors. Homeowners should arrange for regular professional maintenance and promptly attend to any potential issues to ensure the ongoing performance and safety of the system. Changing filters as recommended by the manufacturer, ensuring outdoor units are clear of debris and vegetation, and checking for any unusual noises or odors when the system is operating, are all recommended practices. This inspection does not provide an exhaustive list of every minor defect or omission with the heating or cooling system. If the system is aged, or if any repairs are needed, we recommend that you have the system evaluated by a licensed HVAC contractor.

Heating and Cooling Details:


Thermostat Location:	Number of Zones:
Living Room	1

9.1: HEATING

Heating Details:

Equipment Type:	Equipment Location:
High Efficiency Furnace	Basement
Equipment Manufacturer:	Manufactured Year:
Goodman	2011
Fuel/Energy Source:	Auxiliary Heating Type:
Electric	Unspecified
Emergency Heating Type:	Functionality:
Unspecified	Operational

Manufactured Year Images:

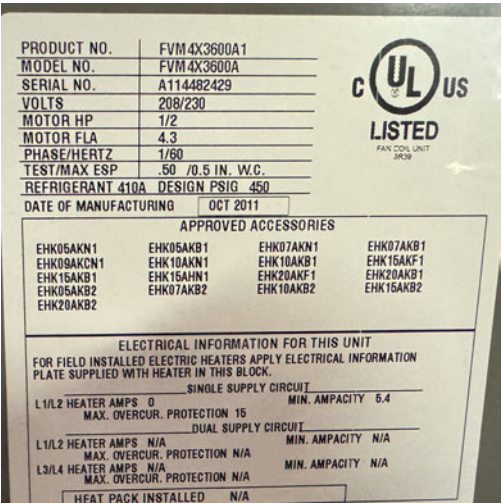

9.2: COOLING

Cooling Details:

Equipment Type:

Conventional Split Unit

Equipment Location:

Rear Side

Equipment Manufacturer:

Heil

Manufactured Year:

2011

Capacity BTU's/Tonnage:

Unspecified

Functionality:

Operational

Cooling Comments

Comment:

The following comments refer to the deficiency for this section:

Description:

- The HVAC system's position was found to be uneven after measured by a 4ft level.

Recommendation Solution:

- Refer to the HVAC technician in order to evaluate the situation and perform required re-alignment on the HVAC system.
- Perform annual maintenance on the HVAC system, such as cleaning the HVAC system.

Remediation:

Contractor

Location:

HVAC (Backyard)

9.2: COOLING



Comment:



The following comments is for information purpose only:

Description:


- “Duct Seal Repair Sealing Clay” can be found on Amazon in order to close the voids between air conditional line and the wall.

Remediation:

Owner

Location:

Air Conditional Line

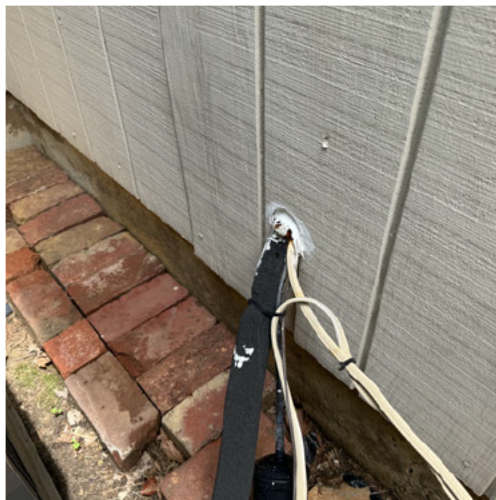

9.2: COOLING

Manufactured Year Images:



Interior Comments

Comment:



The following comments is for information purpose only:

Description:

- The humidity in the basement is high according to the humidity sensor. Highly advised to place a dehumidifier in the basement to remove excess humidity.

Remediation:

Owner

Location:

Basement Humidity



Comment:



The following comments refer to the deficiency for this section:

Description:

- Handrail is missing as shown in the photo.

Recommendation Solution:


- Highly recommend to install the staircase handrail to prevent safety hazard especially when kids frequently use the staircase.

Remediation:

Contractor

Location:

Staircase

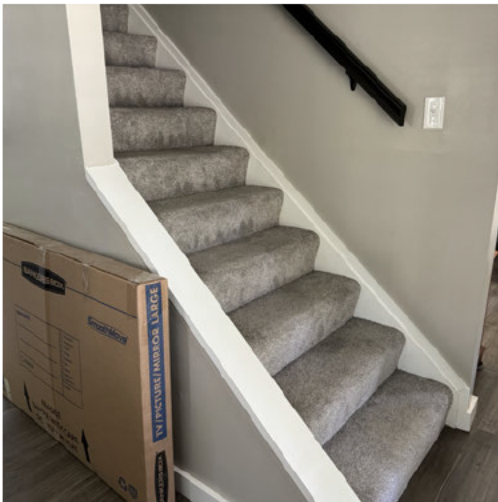

Comment:



The following comments is for information purpose only:

Description:

- Thick dust lining was found in the air duct as shown in the photo.
- Highly recommend air duct cleaning company to clean the air duct system to prevent any respiratory sickness.

Remediation:

Contractor

Location:

Air Duct System



Comment:



The following comments refer to the deficiency for this section:

Description:

- The 2 electric GFCI outlet in the Master Bedroom are not working.

Recommendation Solution:

- Refer to electrician to evaluate the electric outlet.

Remediation:

Contractor

Location:

Master Bedroom
Bathroom



Comment:



The following comments refer to the deficiency for this section:

Description:

- The support of the staircase is loose as shown in the photo.

Recommendation Solution:

- Redo the wood column by removing the column, re-align the wood column, and tighten the wood column as discussed during the inspection.

Remediation:

Contractor

Location:

Basement Staircase



11.9: GARAGE DOOR OPENER

Garage Door Opener Details:

Functionality:

Operational

12: ATTIC

The inspection of the attic includes a visual examination of the accessible areas at the time of the inspection. This may include the framing, insulation, ventilation, and signs of water penetration. Please note that this inspection is limited to visible and accessible areas only. Insulation, stored items, or personal belongings may conceal underlying components and defects. Any areas deemed unsafe due to the risk of damage to the property or inspector, such as areas with inadequate flooring, low headroom, or potentially harmful substances like asbestos, may also be excluded. While every effort is made to identify visible deficiencies and potential issues, this inspection does not imply or guarantee future conditions or predict future failures, including roof leaks. It is also beyond the scope of this inspection to determine the adequacy of the insulation or ventilation, or to provide a comprehensive analysis of energy efficiency. Due to the limited visual inspection, hidden problems may exist. If more detailed information is desired, an invasive inspection performed by a qualified professional should be considered. Regular monitoring of the attic for changes in conditions is also advised. If the house is equipped with a pull-down ladder to access the attic, homeowners should ensure the ladder is safe and stable before use. It is also recommended to keep the attic free of excessive personal belongings to allow for a thorough inspection in the future. Repairs or alterations relating to the attic should only be carried out by licensed professionals. If the attic contains vermiculite insulation, which may contain asbestos, do not disturb it. Contact an asbestos abatement contractor for further evaluation. In conclusion, this report does not claim to identify every defect that may exist in the attic. We recommend that you have any alterations, repairs, or suspect areas evaluated by a qualified contractor.

Attic Details:

Attic Access Type:

Scuttle Hatch

Attic Access Location:

Hallway

Ventilation Type:

Powered Ventilation

Insulation Type:

Fiberglass Batts

12: ATTIC


Insulation Depth:

15"

Roof Decking Type:

Dimensional Boards

Insulation Type Images:

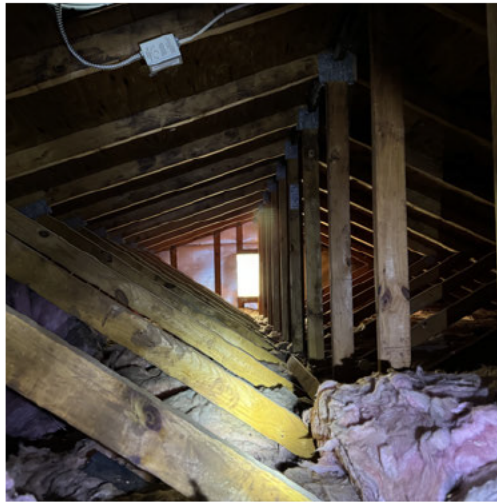

Insulation Type Comments:

Comment:



The following comments refer to the deficiency for this section:

Description:

- Empty space was found uncovered by insulation as shown in the photo.

Recommendation Solution:

- Place the extra insulation material as shown in the photo.

Remediation:

Owner

Location:

Attic (Hallway Area)

12: ATTIC



REPORT SUMMARY

Header:

This summary page is not the entire report. The complete report may include additional information of interest or concern to you. It is strongly recommended that you promptly read the complete report. For information regarding the negotiability of any item in this report under the real estate purchase contract, contact your real estate agent or an attorney.

Exterior Comments:

Comment:



The following comments refer to the deficiency for this section:

Description:

- Standing water was found in the gutter.
- Plants was found growing in the gutter.
- The uneven slope on the left portion of the gutter prevents the water to properly flow out from the gutter as shown in the photos.

Recommendation Solution:

- Remove all the plants and leafs in the gutter.
- Recommend to open an opening on the left side of the gutter to allow the water to flow out from the gutter system as discussed during the inspection.

Remediation:

Contractor

Location:

Front Yard Gutter

REPORT SUMMARY



Plumbing, Water Heater Comments:

Comment:



The following comments refer to the deficiency for this section:

Description:

- The water heater tank is missing the temporary relieve valve (TPR Valve). This needs to be install because the temperature of the water that flow out from this valve is really high.

Recommendation Solution:

- Refer to water heater technician to evaluate the situation and perform proper repair.

Remediation:

Contractor

Location:

Water Heater



Plumbing, Fixtures, Traps, and Shutoffs Comments:

Comment:



The following comments refer to the deficiency for this section:

Description:

- The sump pump is still functions properly, however, it is obvious that it past its life expentency.

Recommendation Solution:

- Highly recommend changing the sump pump in the upcoming days.

Remediation:

Contractor

Location:

Sump Pump



Heating and Cooling, Cooling Comments:

Comment:



The following comments refer to the deficiency for this section:

Description:

- The HVAC system's position was found to be uneven after measured by a 4ft level.

Recommendation Solution:

- Refer to the HVAC technician in order to evaluate the situation and perform required re-alignment on the HVAC system.
- Perform annual maintenance on the HVAC system, such as cleaning the HVAC system.

Remediation:

Contractor

Location:

HVAC (Backyard)



Interior Comments:

Comment:



The following comments refer to the deficiency for this section:

Description:

- Handrail is missing as shown in the photo.

Recommendation Solution:

- Highly recommend to install the staircase handrail to prevent safety hazard especially when kids frequently use the staircase.

Remediation:

Contractor

Location:

Staircase



Interior Comments:

Comment:



The following comments refer to the deficiency for this section:

Description:

- The 2 electric GFCI outlet in the Master Bedroom are not working.

Recommendation Solution:

- Refer to electrician to evaluate the electric outlet.

Remediation:

Contractor

Location:

Master Bedroom
Bathroom



Interior Comments:

Comment:



The following comments refer to the deficiency for this section:

Description:

- The support of the staircase is loose as shown in the photo.

Recommendation Solution:

- Redo the wood column by removing the column, re-align the wood column, and tighten the wood column as discussed during the inspection.

Remediation:

Contractor

Location:

Basement Staircase



Attic, Insulation Type Comments:

Comment:



The following comments refer to the deficiency for this section:

Description:

- Empty space was found uncovered by insulation as shown in the photo.

Recommendation Solution:

- Place the extra insulation material as shown in the photo.

Remediation:

Owner

Location:

Attic (Hallway Area)



INSPECTION INFORMATION

The summary section of the report are items as components, systems, and materials that are inhibiting either safety, function or were determined by the inspector to be important enough to be in this section. It is encouraged to review the entire report for a complete understanding of the home

Inspected by :

Mark

mypropinspection@gmail.com

9293868587

M.Y Property Inspection LLC

Inspection Date & Time: